


DIMENSIONI/DIMENSIONS/ABMESSUNGEN/DIMENSIONS/DIMENSIONES

3MA 63-132

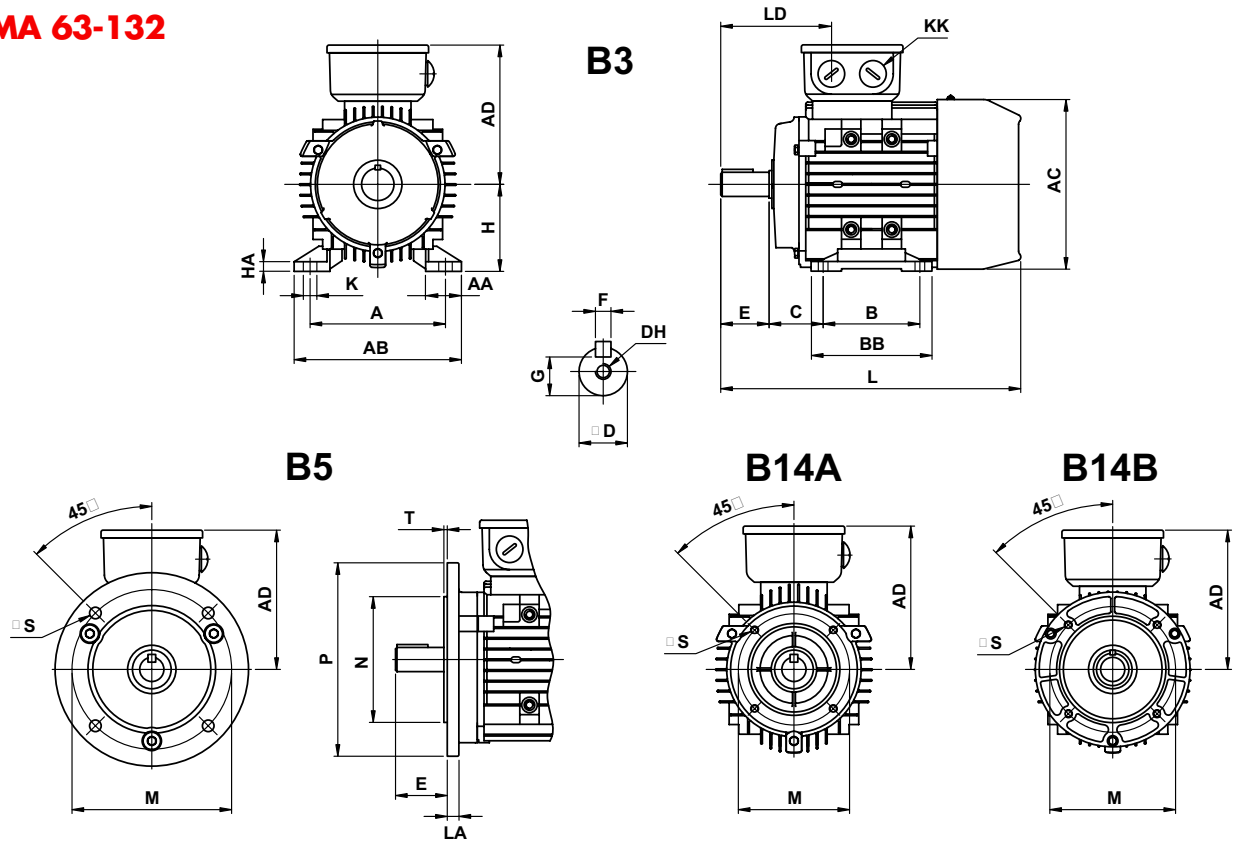

| B3 | A | AA | AB | AC | AD | B | BB | C | D | DH | E | F | G | H | HA | K | KK | L | LD |
|------------------|-----|----|-----|-----|-----|-----|-----|----|----|--------|----|----|------|-----|-----|----|-------------|-----|-----|
| 3MA 63 | 100 | 24 | 135 | 130 | 111 | 80 | 100 | 40 | 11 | M4x12 | 23 | 4 | 8,5 | 63 | 7,5 | 7 | 1 x Pg 13,5 | 217 | 104 |
| 3MA 71 | 112 | 26 | 150 | 145 | 118 | 90 | 110 | 45 | 14 | M5x12 | 30 | 5 | 11 | 71 | 8 | 7 | 1 x Pg 13,5 | 245 | 115 |
| 3MA 80 | 125 | 35 | 165 | 175 | 134 | 100 | 125 | 50 | 19 | M6x16 | 40 | 6 | 15,5 | 80 | 9 | 10 | 2 x Pg 16 | 287 | 124 |
| 3MA 90S | 140 | 37 | 180 | 195 | 140 | 100 | 125 | 56 | 24 | M8x19 | 50 | 8 | 20 | 90 | 10 | 10 | 2 x Pg 16 | 315 | 141 |
| 3MA 90L | 140 | 37 | 180 | 195 | 140 | 125 | 150 | 56 | 24 | M8x19 | 50 | 8 | 20 | 90 | 10 | 10 | 2 x Pg 16 | 340 | 141 |
| 3MA 100 | 160 | 40 | 205 | 215 | 160 | 140 | 172 | 63 | 28 | M10x22 | 60 | 8 | 24 | 100 | 10 | 12 | 2 x Pg 21 | 385 | 147 |
| 3MA 112 | 190 | 41 | 230 | 240 | 178 | 140 | 181 | 70 | 28 | M10x22 | 60 | 8 | 24 | 112 | 12 | 12 | 2 x Pg 21 | 400 | 156 |
| 3MA 132S-SA | 216 | 51 | 270 | 275 | 206 | 140 | 186 | 89 | 38 | M12x28 | 80 | 10 | 33 | 132 | 13 | 12 | 2 x Pg 21 | 483 | 184 |
| 3MA 132M-MA-MB-L | 216 | 51 | 270 | 275 | 206 | 178 | 224 | 89 | 38 | M12x28 | 80 | 10 | 33 | 132 | 16 | 12 | 2 x Pg 21 | 510 | 184 |

| B5 | M | N | P | S | T | LA |
|------------------|-----|-----|-----|----|-----|----|
| 3MA 63 | 115 | 95 | 140 | 10 | 3 | 10 |
| 3MA 71 | 130 | 110 | 160 | 10 | 3,5 | 10 |
| 3MA 80 | 165 | 130 | 200 | 12 | 3,5 | 12 |
| 3MA 90S | 165 | 130 | 200 | 12 | 3,5 | 12 |
| 3MA 90L | 165 | 130 | 200 | 12 | 3,5 | 12 |
| 3MA 100 | 215 | 180 | 250 | 15 | 4 | 13 |
| 3MA 112 | 215 | 180 | 250 | 15 | 4 | 14 |
| 3MA 132S-SA | 265 | 230 | 300 | 15 | 4 | 14 |
| 3MA 132M-MA-MB-L | 265 | 230 | 300 | 15 | 4 | 14 |

| B14A | M | N | P | S | T | LA |
|------------------|-----|-----|-----|-----|-----|----|
| 3MA 63 | 75 | 60 | 90 | M5 | 2,5 | 10 |
| 3MA 71 | 85 | 70 | 105 | M6 | 2,5 | 10 |
| 3MA 80 | 100 | 80 | 120 | M6 | 3 | 12 |
| 3MA 90S | 115 | 95 | 140 | M8 | 3 | 12 |
| 3MA 90L | 115 | 95 | 140 | M8 | 3 | 12 |
| 3MA 100 | 130 | 110 | 160 | M8 | 3,5 | 13 |
| 3MA 112 | 130 | 110 | 160 | M8 | 3,5 | 14 |
| 3MA 132S-SA | 165 | 130 | 200 | M10 | 3,5 | 14 |
| 3MA 132M-MA-MB-L | 165 | 130 | 200 | M10 | 3,5 | 14 |

| B14B | M | N | P | S | T | LA |
|------------------|-----|-----|-----|-----|-----|----|
| 3MA 63 | 85 | 70 | 105 | M6 | 2,5 | 10 |
| 3MA 71 | 115 | 95 | 140 | M8 | 3 | 10 |
| 3MA 80 | 130 | 110 | 160 | M8 | 3,5 | 12 |
| 3MA 90S | 130 | 110 | 160 | M8 | 3,5 | 12 |
| 3MA 90L | 130 | 110 | 160 | M8 | 3,5 | 12 |
| 3MA 100 | 165 | 130 | 200 | M10 | 3,5 | 13 |
| 3MA 112 | 165 | 130 | 200 | M10 | 3,5 | 14 |
| 3MA 132S-SA | 215 | 180 | 250 | M12 | 4 | 14 |
| 3MA 132M-MA-MB-L | 215 | 180 | 250 | M12 | 4 | 14 |

TOLLERANZE:

Quota H = +0 -0,5mm
 Quota N = h6
 Quota D = ≤ 28 = j6
 = 38 = k6
 Le dimensioni non sono impegnative.

TOLERANCES:

Cote H = +0 -0,5mm
 Cote N = h6
 Cote D = ≤ 28 = j6
 = 38 = k6
 Les dimensions ne sont pas impératives.

TOLERANZEN:

Mass H = +0 -0,5mm (225 ... 250)
 Mass N = h6
 Mass D = ≤ 28 = j6
 = 38 = k6
 Die Abmessungen sind nicht verbindlich.

TOLERANCIAS:

Cotas H = +0 -0,5mm
 Cotas N = h6
 Cotas D = ≤ 28 = j6
 = 38 = k6
 Las dimensiones son orientativas.

TOLERANCES:

Dimension H = +0 -0,5mm
 Dimension N = h6
 Dimension D = ≤ 28 = j6
 = 38 = k6
 Dimensions are not binding.